



## dsPIC30F5015/5016 Family Silicon Errata and Data Sheet Clarification

The dsPIC30F5015/5016 family devices that you have received conform functionally to the current Device Data Sheet (DS70149D), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. The silicon issues are summarized in Table 2.

The errata described in this document will be addressed in future revisions of the dsPIC30F5015/5016 silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of Table 2 apply to the current silicon revision (A0).

Data Sheet clarifications and corrections start on page 14, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site ([www.microchip.com](http://www.microchip.com)).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 2 or PICKIT™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 2 programmer/debugger or PICKIT 3.
2. From the main menu in MPLAB IDE, select Configure>Select Device, and then select the target part number in the dialog box.
3. Select the MPLAB hardware tool (Debugger>Select Tool).
4. Perform a "Connect" operation to the device (Debugger>Connect). Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various dsPIC30F5015/5016 silicon revisions are shown in Table 1.

**TABLE 1: SILICON DEVREV VALUES**

| Part Number  | Device ID <sup>(1)</sup> | Revision ID for Silicon Revision <sup>(2)</sup> |
|--------------|--------------------------|---|
|              |                          | A0  |
| dsPIC30F5015 | 0x0200                   | 0x1000  |
| dsPIC30F5016 | 0x0201                   |   |

- Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.
- 2:** Refer to the "dsPIC30F Flash Programming Specification" (DS70102) for detailed information on Device and Revision IDs for your specific device.

# dsPIC30F5015/5016

**TABLE 2: SILICON ISSUE SUMMARY**

| Module            | Feature                       | Item Number | Issue Summary  | Affected Revisions <sup>(1)</sup> |
|-------------------|-------------------------------|-------------|--|-----------------------------------|
|                   |                               |             |  | A0                                |
| CPU               | DISI Instruction              | 1.          | The DISI instruction will not disable interrupts if a DISI instruction is executed in the same instruction cycle that the DISI counter decrements to zero.   | X                                 |
| Output Compare    | —                             | 2.          | The output compare module will produce a glitch on the output when an I/O pin is initially set high and the module is configured to drive the pin low at a specified time.   | X                                 |
| Output Compare    | PWM Mode                      | 3.          | Output compare will produce a glitch when loading 0% duty cycle in PWM mode. It will also miss the next compare after the glitch.  | X                                 |
| QEI               | Error Count Detection         | 4.          | The Index Pulse Reset mode of the QEI does not work properly when used along with error count detection. When counting upwards, the POSCNT register will increment one extra count after the index pulse is received. The extra count will generate a false count error interrupt. | X                                 |
| ADC               | Sleep Mode                    | 5.          | ADC event triggers from the INTO pin will not wake-up the device from Sleep mode if the SMPI bits are non-zero.  | X                                 |
| ADC               | Sampling Rate                 | 6.          | The 10-bit Analog-to-Digital Converter (ADC) has a maximum sampling rate of 750 ksp/s.   | X                                 |
| QEI               | Interrupt Generation          | 7.          | The QEI module does not generate an interrupt in a particular overflow condition.  | X                                 |
| Sleep Mode        | —                             | 8.          | Execution of the Sleep instruction (PWRSAV #0) may cause incorrect program operation after the device wakes up from Sleep. The current consumption during Sleep may also increase beyond the specifications listed in the device data sheet.                                       | X                                 |
| I <sup>2</sup> C™ | Slave Mode                    | 9.          | The I <sup>2</sup> C module loses incoming data bytes when operating as an I <sup>2</sup> C slave.   | X                                 |
| PWM               | Debug Mode                    | 10.         | PTMR does not continue counting down after halting code execution in Debug mode.   | X                                 |
| I/O               | Port Pin Multiplexed with IC1 | 11.         | The Port I/O pin multiplexed with the Input Capture 1 (IC1) function cannot be used as a digital input pin when the UART auto-baud feature is enabled.   | X                                 |
| I <sup>2</sup> C  | 10-bit Addressing             | 12.         | When the I <sup>2</sup> C module is configured for 10-bit addressing using the same address bits (A10 and A9) as other I <sup>2</sup> C devices, the A10 and A9 bits may not work as expected.   | X                                 |
| Timer             | Sleep Mode                    | 13.         | Clock switching prevents the device from waking up from Sleep.   | X                                 |
| PLL               | Lock Status bit               | 14.         | The PLL LOCK Status bit (OSCCON<5>) can occasionally get cleared and generate an oscillator failure trap even when the PLL is still locked and functioning correctly.  | X                                 |
| PSV Operations    | —                             | 15.         | An address error trap occurs in certain addressing modes when accessing the first four bytes of any PSV page.  | X                                 |
| I <sup>2</sup> C  | 10-bit Addressing             | 16.         | The 10-bit slave does not set the RBF flag or load the I2CxRCV register on address match if the Least Significant bits (LSBs) of the address are the same as the 7-bit reserved addresses.   | X                                 |
| I <sup>2</sup> C  | 10-bit Addressing             | 17.         | When the I <sup>2</sup> C module is configured as a 10-bit slave with an address of 0x102, the I2CxRCV register content for the lower address byte is 0x01 rather than 0x02.   | X                                 |

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

**TABLE 2: SILICON ISSUE SUMMARY (CONTINUED)**

| Module           | Feature                           | Item Number | Issue Summary   | Affected Revisions <sup>(1)</sup> |
|------------------|-----------------------------------|-------------|---|-----------------------------------|
|                  |                                   |             |   | A0                                |
| I <sup>2</sup> C | Bus Collision                     | 18.         | When the I <sup>2</sup> C module is enabled, the dsPIC <sup>®</sup> DSC device generates a glitch on the SDA and SCL pins, causing a false communication start in a single-master configuration or a bus collision in a multi-master configuration. | X                                 |
| CAN              | RX Filters 3, 4 and 5             | 19.         | CAN Receive filters 3, 4 and 5 may not work for a given combination of instruction cycle speed and CAN bit time quanta.   | X                                 |
| QEI              | Timer Gated Accumulation Mode     | 20.         | When Timer Gated Accumulation is enabled, the QEI does not generate an interrupt on every falling edge.   | X                                 |
| QEI              | Timer Gated Accumulation Mode     | 21.         | When Timer Gated Accumulation is enabled, and an external signal is applied, the POSCNT increments and generates an interrupt after a match with MAXCNT.  | X                                 |
| ADC              | Current Consumption in Sleep Mode | 22.         | If the ADC module is in an enabled state when the device enters Sleep Mode, the power-down current (I <sub>PD</sub> ) of the device may exceed the device data sheet specifications.  | X                                 |

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A0**).

### 1. Module: CPU

When a user executes a `DISI #7`, for example, this will disable interrupts for  $7 + 1$  cycles ( $7 +$  the `DISI` instruction itself). In this case, the `DISI` instruction uses a counter which counts down from 7 to 0. The counter is loaded with 7 at the end of the `DISI` instruction.

If the user code executes another `DISI` on the instruction cycle where the `DISI` state machine does not properly re-engage and continue to disable interrupts. At this point, all interrupts are enabled. The next time the user code executes a `DISI` instruction, the feature will act normally and block interrupts.

In summary, it is only when a `DISI` execution is coincident with the current `DISI` count = 0, that the issue occurs. Executing a `DISI` instruction before the `DISI` counter reaches zero will not produce this error. In this case, the `DISI` counter is loaded with the new value, and interrupts remain disabled until the counter becomes zero.

#### Work around

When executing multiple `DISI` instructions within the source code, make sure that subsequent `DISI` instructions have at least one instruction cycle between the time that the `DISI` counter decrements to zero and the next `DISI` instruction. Alternatively, make sure that subsequent `DISI` instructions are called before the `DISI` counter decrements to zero.

#### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

### 2. Module: Output Compare

A glitch will be produced on an output compare pin under the following conditions:

- The user software initially drives the I/O pin high using the output compare module or a write to the associated PORT register.
- The output compare module is configured and enabled to drive the pin low at some point in later time ( $OCxCON = 0x0002$  or  $OCxCON = 0x0003$ ).

When these events occur, the output compare module will drive the pin low for one instruction cycle ( $T_{CY}$ ) after the module is enabled.

#### Work around

None. However, the user may use a Timer interrupt and write to the associated PORT register to control the pin manually.

#### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

### 3. Module: Output Compare

If the desired duty cycle is '0' ( $OCxRS = 0$ ), the module will generate a high level glitch of  $1 T_{CY}$ . The second problem is that on the next cycle after the glitch, the OC pin does not go high, or in other words, it misses the next compare for any value written on `OCxRS`.

#### Work around

There are two possible solutions to this problem:

1. Load a value greater than '0' to the `OCxRS` register when operating in PWM mode. In this case, no 0% duty cycle is achievable.
2. If the application requires 0% duty cycles, the output compare module can be disabled for 0% duty cycles, and re-enabled for non-zero percent duty cycles.

#### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 4. Module: QEI

The Index Pulse Reset mode of the Quadrature Encoder Interface (QEI) does not work properly when used along with count error detection. When counting upwards, the POSCNT register will increment one extra count after the index pulse is received. The extra count will generate a false count error interrupt.

### Work around

There are multiple work arounds for this issue, depending on the specific requirements of the application:

1. Ignore count error interrupts when the counting direction is upwards and the POSCNT register has the value of MAXCNT + 1.
2. The user may disable count error interrupts by setting the CEID bit in the DFLTCON register.
3. The user may disable the index pulse reset feature by clearing the POSRES bit (QEICON<2>). Writing QEICON = 0x0600 will provide a QEI interrupt each time an index pulse is received, but the POSCNT register will not be modified. The POSCNT register value can be read in the QEI interrupt handler and used as an offset value to calculate the absolute position of the encoder disc with respect to the index pulse.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 5. Module: ADC

ADC event triggers from the INT0 pin will not wake-up the device from Sleep mode if the SMPI bits are non-zero. This means that if the ADC is configured to generate an interrupt after a certain number of INT0 triggered conversions, the ADC conversions will not be triggered and the device will remain in Sleep. The ADC will perform conversions and wake-up the device only if it is configured to generate an interrupt after each INT0 triggered conversion (SMPI<3:0> = 0000).

### Work around

None. If ADC event trigger from the INT0 pin is required, initialize SMPI<3:0> TO '0000' (interrupt on every conversion).

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

# dsPIC30F5015/5016

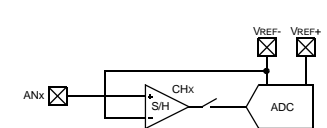
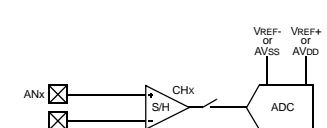
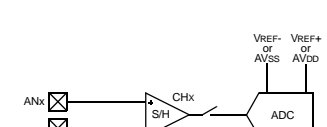
## 6. Module: ADC

The maximum sampling rate for the 10-bit Analog-to-Digital Conversion module is 750 ksps.

This rate is only achievable when one A/D pin is being used. Configuring the ADC module to use multiple sample-and-hold circuits (see device data sheet) will not improve the conversion speed of the module.

Table 3 shows the maximum ADC conversion rates possible using the 10-bit ADC module and the corresponding module configuration and operating conditions.

**TABLE 3: 10-BIT ADC RATE PARAMETERS**

| dsPIC30F 10-bit ADC Conversion Rates |             |                   |        |              |                 |   |
|--------------------------------------|-------------|-------------------|--------|--------------|-----------------|---|
| A/D Speed                            | TAD Minimum | Sampling Time Min | Rs Max | VDD          | Temperature     | A/D Channels Configuration  |
| Up to 750 ksps                       | 95.24 ns    | 2 TAD             | 500Ω   | 4.5V to 5.5V | -40°C to +85°C  |    |
| Up to 500 ksps                       | 153.85 ns   | 1 TAD             | 5.0 kΩ | 4.5V to 5.5V | -40°C to +125°C |   |
| Up to 300 ksps                       | 256.41 ns   | 1 TAD             | 5.0 kΩ | 3.0V to 5.5V | -40°C to +125°C |  |

### Work around

None.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 7. Module: QEI

The Quadrature Encoder Interface (QEI) module does not generate an interrupt when MAXCNT is set to 0xFFFF and the following events occur:

1. POSCNT underflows from 0x0000 to 0xFFFF.
2. POSCNT stops.
3. POSCNT overflows from 0xFFFF to 0x0000.

This sequence of events occurs when the motor is running in one direction, which causes POSCNT to underflow to 0xFFFF. Once this happens, the motor stops and starts to run in the opposite direction, which generates an overflow from 0xFFFF to 0x0000. The QEI module does not generate an interrupt when this condition occurs.

### Work around

To prevent this condition from occurring, set MAXCNT to 0x7FFF, which will cause an interrupt to be generated by the QEI module.

In addition, a global variable could be used to keep track of bit 15, so that when an overflow or underflow condition is present on POSCNT, the variable will toggle bit 15. Example 1 shows the code required for this global variable.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

### **EXAMPLE 1:**

```

unsigned int POSCNT_b15 = 0;
unsigned int Motor_Position = 0;

int main(void)
{
    // ... User's code

    MAXCNT = 0x7FFF;      // Instead of 0xFFFF

    Motor_Position = POSCNT_b15 + POSCNT;

    // ... User's code
}

void __attribute__((__interrupt__)) _QEInterrupt(void)
{
    IFSxbits.QEIIF = 0;   // Clear QEI interrupt flag
                        // x=2 for dsPIC30F
                        // x=3 for dsPIC33F
    POSCNT_b15 ^= 0x8000; // Overflow or Underflow
}

```

# dsPIC30F5015/5016

## 8. Module: Sleep Mode

Execution of the Sleep instruction (PWRSAV #0) may cause incorrect program operation after the device wakes up from Sleep. The current consumption during Sleep may also increase beyond the specifications listed in the device data sheet.

### Work arounds

To avoid this issue, implement any of the following three work arounds, depending on the application requirements.

#### Work around 1:

Ensure that the PWRSAV #0 instruction is located at the end of the last row of program Flash memory available on the target device and fill the remainder of the row with NOP instructions.

This can be accomplished by replacing all occurrences of the PWRSAV #0 instruction with a function call to a suitably aligned subroutine. The address( ) attribute provided by the MPLAB ASM30 assembler can be utilized to correctly align the instructions in the subroutine. For an application written in C, the function call would be GotoSleep( ), while for an assembly language application, the function call would be CALL \_GotoSleep.

The address error trap service routine software can then replace the invalid return address saved on the stack with the address of the instruction immediately following the \_GotoSleep or GotoSleep( ) function call. This ensures that the device continues executing the correct code sequence after waking up from Sleep mode.

Example 2 demonstrates the work around described above.

### EXAMPLE 2:

```
-----  
; -----  
.global __reset  
.global _main  
.global _GotoSleep  
.global __AddressError  
.global __INT1Interrupt  
; -----  
; .section *, code  
_main:  
  BSET   INTCON2, #INT1EP   ; Set up INT pins to detect falling edge  
  BCLR   IFS1, #INT1IF     ; Clear interrupt pin interrupt flag bits  
  BSET   IEC1, #INT1IE     ; Enable ISR processing for INT pins  
  CALL   _GotoSleep        ; Call function to enter SLEEP mode  
_continue:  
  BRA   _continue  
; -----  
; Address Error Trap  
__AddressError:  
  BCLR   INTCON1, #ADDRERR  
  ; Set program memory return address to _continue  
  POP.D  W0  
  MOV.B  #tblpage (_continue), W1  
  MOV    #tbloffset (_continue), W0  
  PUSH.D W0  
  RETFIE  
; -----  
__INT1Interrupt:  
  BCLR   IFS1, #INT1IF     ; Ensure flag is reset  
  RETFIE                    ; Return from Interrupt Service Routine  
; -----  
; .section *, code, address (0x1FC0)  
_GotoSleep:  
; fill remainder of the last row with NOP instructions  
  .rept 31  
    NOP  
  .endr  
; Place SLEEP instruction in the last word of program memory  
  PWRSAV #0
```



## Work around 2:

Instead of executing a `PWRSV #0` instruction to put the device into Sleep mode, perform a clock switch to the 512 kHz Low-Power RC (LPRC) Oscillator with a 64:1 postscaler mode. This enables the device to operate at 0.002 MIPS, thereby significantly reducing the current consumption of the device. Similarly, instead of using an interrupt to wake-up the device from Sleep mode, perform another clock switch back to the original oscillator source to resume normal operation. Depending on the device, refer to **Section 7. "Oscillator"** (DS70054) or **Section 29. "Oscillator"** (DS70268) in the "*dsPIC30F Family Reference Manual*" (DS70046) for more details on performing a clock switch operation.

**Note:** The above work around is recommended for users for whom application hardware changes are not possible.

## Work around 3:

Instead of executing a `PWRSV #0` instruction to put the device into Sleep mode, perform a clock switch to the 32 kHz Low-Power (LP) Oscillator with a 64:1 postscaler mode. This enables the device to operate at 0.000125 MIPS, thereby significantly reducing the current consumption of the device. Similarly, instead of using an interrupt to wake-up the device from Sleep mode, perform another clock switch back to the original oscillator source to resume normal operation. Depending on the device, refer to **Section 7. "Oscillator"** (DS70054) or **Section 29. "Oscillator"** (DS70268) in the "*dsPIC30F Family Reference Manual*" (DS70046) for more details on performing a clock switch operation.

**Note:** The above work around is recommended for users for whom application hardware changes are possible, and also for users whose application hardware already includes a 32 kHz LP Oscillator crystal.

## Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 9. Module: I<sup>2</sup>C

When the I<sup>2</sup>C module is configured as a slave, either in single-master or multi-master mode, the I<sup>2</sup>C receiver buffer is filled whether a valid slave address is detected or not. Therefore, an I<sup>2</sup>C receiver overflow condition occurs and this condition is indicated by the I2COV flag in the I2CSTAT register.

This overflow condition inhibits the ability to set the I<sup>2</sup>C receive interrupt flag (SI2CF) when the last valid data byte is received. Therefore, the I<sup>2</sup>C slave Interrupt Service Routine (ISR) is not called and the I<sup>2</sup>C receiver buffer is not read prior receiving the next data byte.

### Work arounds

To avoid this issue, either of the following two work arounds can be implemented, depending on the application requirements.

#### **Work around 1:**

For applications in which the I<sup>2</sup>C receiver interrupt is not required, the following procedure can be used to receive valid data bytes:

1. Wait until the RBF flag is set.
2. Poll the I<sup>2</sup>C receiver interrupt SI2CIF flag.
3. If SI2CF is not set in the corresponding Interrupt Flag Status (IFSx) register, a valid address or data byte has not been received for the current slave. Execute a dummy read of the I<sup>2</sup>C receiver buffer, I2CRCV; this will clear the RBF flag. Go back to step 1 until SI2CF is set and then continue to Step 4.
4. If the SI2CF is set in the corresponding Interrupt Flag Status (IFSx) register, valid data has been received. Check the D\_A flag to verify that an address or a data byte has been received.
5. Read the I2CRCV buffer to recover valid data bytes. This will also clear the RBF flag.
6. Clear the I<sup>2</sup>C receiver interrupt flag SI2CF.
7. Go back to step 1 to continue receiving incoming data bytes.

#### **Work around 2:**

Use this work around for applications in which the I<sup>2</sup>C receiver interrupt is required. Assuming that the RBF and the I2COV flags in the I2CSTAT register are set due to previous data transfers in the I<sup>2</sup>C bus (i.e., between master and other slaves); the following procedure can be used to receive valid data bytes:

1. When a valid slave address byte is detected, SI2CF bit is set and the I<sup>2</sup>C slave interrupt service routine is called; however, the RBF and I2COV bits are already set due to data transfers between other I<sup>2</sup>C nodes.
2. Check the status of the D\_A flag and the I2COV flag in the I2CSTAT register when executing the I<sup>2</sup>C slave service routine.
3. If the D\_A flag is cleared and the I2COV flag are set, an invalid data byte was received but a valid address byte was received. The overflow condition occurred because the I<sup>2</sup>C receive buffer was overflowing with previous I<sup>2</sup>C data transfers between other I<sup>2</sup>C nodes. This condition only occurs after a valid slave address was detected.
4. Clear the I2COV flag and perform a dummy read of the I<sup>2</sup>C receiver buffer, I2CRCV, to clear the RBF bit and recover the valid address byte. This action will also avoid the loss of the next data byte due to an overflow condition.
5. Verify that the recovered address byte matches the current slave address byte. If they match, the next data to be received is a valid data byte.
6. If the D\_A flag and the I2COV flag are both set, a valid data byte was received and a previous valid data byte was lost. It will be necessary to code for handling this overflow condition.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 10. Module: PWM

If the PTDIR bit is set (when PTMR is counting down), and the CPU execution is halted (after a breakpoint is reached), PTMR will start counting up as if PTDIR was zero.

### Work around

None.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 11. Module: I/O

If the user application enables the auto-baud feature in the UART module, the I/O pin multiplexed with the IC1 (Input Capture) pin cannot be used as a digital input. However, the external interrupt function (INT1) can be used.

### Work around

None.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 12. Module: I<sup>2</sup>C

If there are two I<sup>2</sup>C devices on the bus, one of them is acting as the Master receiver and the other as the Slave transmitter. If both devices are configured for 10-bit addressing mode, and have the same value in the A10 and A9 bits of their addresses, then when the Slave select address is sent from the Master, both the Master and Slave acknowledge it. When the Master sends out the read operation, both the Master and the Slave enter into Read mode and both of them transmit the data. The resultant data will be the ANDing of the two transmissions.

### Work around

In all I<sup>2</sup>C devices, the addresses as well as bits A10 and A9 should be different.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 13. Module: Timer

When the timer is being operated in Asynchronous mode using the secondary oscillator (32.768 kHz) and the device is put into Sleep mode, a clock switch to any other oscillator mode before putting the device to Sleep prevents the timer from waking the device from Sleep.

### Work around

Do not clock switch to any other oscillator mode if the timer is being used in Asynchronous mode using the secondary oscillator (32.768 kHz).

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 14. Module: PLL

The PLL LOCK Status bit (OSCCON<5>) can occasionally get cleared and generate an oscillator failure trap even when the PLL is still locked and functioning correctly.

### Work around

The user application must include an oscillator failure Trap Service Routine (TSR). In the trap service routine, first inspect the status of the Clock Failure Status bit (OSCCON<3>). If this bit is clear, return from the trap service routine immediately and continue program execution.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 15. Module: PSV Operations

An address error trap occurs in certain addressing modes when accessing the first four bytes of an PSV page. This only occurs when using the following addressing modes:

- MOV.D
- Register Indirect Addressing (word or byte mode) with pre/post-decrement

### Work around

Do not perform PSV accesses to any of the first four bytes using the above addressing modes. For applications using the C language, MPLAB C30 version 3.11 or higher, provides the following command-line switch that implements a work around for the erratum.

```
-merrata=psv_trap
```

Refer to the `readme.txt` file in the MPLAB C30 v3.11 tool suite for further details.

### Affected Silicon Revisions

|    |  |  |  |  |  |  |  |
|----|--|--|--|--|--|--|--|
| A0 |  |  |  |  |  |  |  |
| X  |  |  |  |  |  |  |  |

## 16. Module: I<sup>2</sup>C

In 10-bit Addressing mode, some address matches don't set the RBF flag or load the receive register I2CxRCV, if the lower address byte matches the reserved addresses. In particular, these include all addresses with the form XX0000XXXX and XX1111XXXX, with the following exceptions:

- 001111000X
- 011111001X
- 101111010X
- 111111011X

### Work around

Ensure that the lower address byte in 10-bit Addressing mode does not match any 7-bit reserved addresses.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 17. Module: I<sup>2</sup>C

When the I<sup>2</sup>C module is configured as a 10-bit slave with an address of 0x102, the I2CxRCV register content for the lower address byte is 0x01 rather than 0x02; however, the module acknowledges both address bytes.

### Work around

None.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 18. Module: I<sup>2</sup>C

When the I<sup>2</sup>C module is enabled by setting the I2CEN bit in the I2CCON register, the dsPIC DSC device generates a glitch on the SDA and SCL pins. This glitch falsely indicates "Communication Start" to all devices on the I<sup>2</sup>C bus, and can cause a bus collision in a multi-master configuration.

Additionally, when the I2CEN bit is set, the S and P bits of the I<sup>2</sup>C module are set to values '1' and '0', respectively, which indicate a "Communication Start" condition.

### Work arounds

To avoid this issue, either of the following two work arounds can be implemented, depending on the application requirements.

#### **Work around 1:**

In a single-master environment, add a delay between enabling the I<sup>2</sup>C module and the first data transmission. The delay should be equal to or greater than the time it takes to transmit two data bits.

In the multi-master configuration, in addition to the delay, all other I<sup>2</sup>C masters should be synchronized and wait for the I<sup>2</sup>C module to be initialized before initiating any kind of communication.

#### **Work around 2:**

In dsPIC DSC devices in which the I<sup>2</sup>C module is multiplexed with other modules that have precedence in the use of the pin, it is possible to avoid this glitch by enabling the higher priority module before enabling the I<sup>2</sup>C module.

Use the following procedure to implement this work around:

1. Enable the higher priority peripheral module that is multiplexed on the same pins as the I<sup>2</sup>C module.
2. Set up and enable the I<sup>2</sup>C module.

Disable the higher priority peripheral module that was enabled in step 1.

**Note:** Work around 2 works only for devices that share the SDA and SCL pins with another peripheral that has a higher precedence over the port latch, such as the UART. The priority is shown in the pin diagram located in the data sheet. For example, if the SDA and SCL pins are shared with the UART and SPI pins, and the UART has higher precedence on the port latch pin.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 19. Module: CAN

CAN Receive filters 3, 4 and 5 may not work for a given combination of instruction cycle speed and CAN bit time quanta.

### Work around

Do not use CAN RX filters 3, 4 and 5. Instead, use filters 0, 1 and 2.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 20. Module: QEI

When the TQCS and TQGATE bits in the QEIXCON register are set, a QEI interrupt should be generated after an input pulse on the QEA input. This interrupt is not generated in the affected silicon.

### Work around

None.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 21. Module: QEI

When the TQCS and TQGATE bits in the QEIXCON register are set, the POSCNT counter should not increment but erroneously does, and if allowed to increment to match MAXCNT, a QEI interrupt will be generated.

### Work around

To prevent the erroneous increment of POSCNT while running the QEI in Timer Gated Accumulation mode, initialize MAXCNT = 0.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

## 22. Module: ADC

If the ADC module is in an enabled state when the device enters Sleep mode as a result of executing a PWRSAV #0 instruction, the device power-down current (IPD) may exceed the specifications listed in the device data sheet. This may happen even if the ADC module is disabled by clearing the ADON bit prior to entering Sleep mode.

### Work around

In order to remain within the IPD specifications listed in the device data sheet, the user software must completely disable the ADC module by setting the ADC Module Disable bit in the corresponding Peripheral Module Disable (PMDx) register, prior to executing a PWRSAV #0 instruction.

### Affected Silicon Revisions

|           |  |  |  |  |  |  |  |
|-----------|--|--|--|--|--|--|--|
| <b>A0</b> |  |  |  |  |  |  |  |
| X         |  |  |  |  |  |  |  |

# dsPIC30F5015/5016

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS70149D):

**Note:** Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

### 1. Module: DC Characteristics: I/O Pin Input Specifications

The maximum value for parameter DI19 ( $V_{IL}$  specifications for SDAx and SCLx pins) and the minimum value for parameter DI29 ( $V_{IH}$  specifications for SDAx and SCLx pins) were stated incorrectly in Table 24-9 of the current device data sheet. The correct values are shown in bold type in Table 4.

**TABLE 4: DC CHARACTERISTICS: I/O PIN INPUT SPECIFICATIONS**

| DC CHARACTERISTICS |          |                                | Standard Operating Conditions: 3.3V and 5.0V ( $\pm 10\%$ )<br>(unless otherwise stated)<br>Operating temperature $-40^{\circ}\text{C} \leq T_A \leq +85^{\circ}\text{C}$ for Industrial<br>$-40^{\circ}\text{C} \leq T_A \leq +125^{\circ}\text{C}$ for Extended |     |            |       |               |
|--------------------|----------|--------------------------------|---|-----|------------|-------|---------------|
| Param No.          | Symbol   | Characteristic                 | Min   | Typ | Max        | Units | Conditions    |
| DI19               | $V_{IL}$ | Input Low Voltage<br>SDA, SCL  | $V_{SS}$  | —   | <b>0.8</b> | V     | SMbus enabled |
| DI29               | $V_{IH}$ | Input High Voltage<br>SDA, SCL | <b>2.1</b>  | —   | $V_{DD}$   | V     | SMbus enabled |

## APPENDIX A: REVISION HISTORY

### Rev A Document (4/2009)

Initial release of this document; issued for revision A0.

Includes silicon issues 1 (CPU), 2 (Output Compare), 3 (Output Compare), 4 (QEI), 5-6 (ADC), 7 (QEI), 8 (Sleep Mode), 9 (I<sup>2</sup>C), 10 (PWM), 11 (I/O), 12 (I<sup>2</sup>C), 13 (Timer), 14 (PLL), 15 (PSV Operations), 16-18 (I<sup>2</sup>C) and 19 (CAN).

This document replaces the following errata document:

- DS80247, “dsPIC30F5015/5016 Rev. A0 Silicon Errata”

### Rev B Document (8/2009)

Added silicon issues 20 (QEI) and 21 (QEI).

### Rev C Document (6/2010)

Added silicon issue 22 (ADC) and data sheet clarification 1 (DC Characteristics: I/O Pin Input Specifications).

# dsPIC30F5015/5016

---

---

NOTES:



---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC<sup>32</sup> logo, rPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Octopus, Omniscient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICkit, PICTail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2010, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 978-1-60932-258-8

*Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC<sup>®</sup> MCUs and dsPIC<sup>®</sup> DSCs, KEELOQ<sup>®</sup> code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*

**QUALITY MANAGEMENT SYSTEM  
CERTIFIED BY DNV  
== ISO/TS 16949:2002 ==**



---

---

## Worldwide Sales and Service

---

---

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://support.microchip.com>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Cleveland**  
Independence, OH  
Tel: 216-447-0464  
Fax: 216-447-0643

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Kokomo**  
Kokomo, IN  
Tel: 765-864-8360  
Fax: 765-864-8387

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8528-2100  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Chongqing**  
Tel: 86-23-8980-9588  
Fax: 86-23-8980-9500

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444  
Fax: 91-80-3090-4123

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-6578-300  
Fax: 886-3-6578-370

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-536-4803

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820

01/05/10